


Chain Drives

Low-speed bush chains

MoraviaŘetězy



Low-speed bush chains - TM20 - TM50

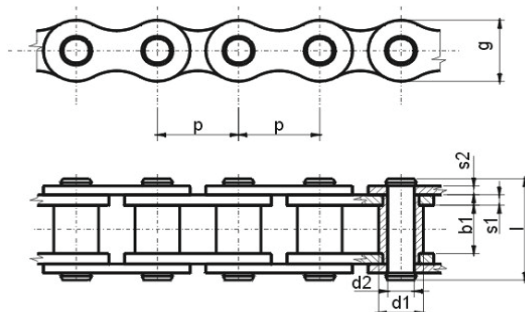

Chain number	Pitch mm	b_1		d_1	d_2	g	s_1	s_2	Chain joint area		Mass
		min mm	max mm	H 11	max mm	max mm	max mm	max mm	l mm	f cm ²	F_B min N
TM 20	20	16	12	7,95	20	3,0	2,5	34	1,7	25 000	2,14
TM 25	25	18	15	9,95	28	3,0	3,0	36	2,3	31 500	2,78
TM 30	30	20	17	10,95	29	4,0	3,5	44	3,0	40 000	4,00
TM 35	35	22	18	11,95	32	4,0	3,5	47	3,5	50 000	4,30
TM 40	40	25	20	13,91	36	4,5	4,0	55	4,8	63 000	5,52
TM 45	45	30	23	16,91	38	6,0	4,5	64	7,0	80 000	6,90
TM 50	50	35	26	17,91	40	6,0	4,5	68	8,4	100 000	7,50

All dimension in mm unless otherwise stated.

Every effort has been taken to ensure that the data listed in this catalogue is correct. MORAVIA RETEZY accepts no liability for any inaccuracies or damage caused.